

INDEPENDENT BATTERY CERTIFICATE



CERTIFICATE NUMBER: 8A2EAB17-AD6D-46F9-BC28-2EB0DDF61620

VEHICLE

BRAND: GWM
MODEL: Ora 3 - 47,8 kWh

MILEAGE: 606 km
VIN: LGWEEUA5XPK627688
DATE AND TIME:
22/02/2026, 22:29:23

EXECUTED BY: Carma

RESULTS

STATE OF HEALTH (SOH)

94.7 %

ENERGY 43kWh | 45kWh




WLTP RANGE 293km | 310km

RATING

BENCHMARKING

How does your vehicle compare to comparable vehicles?

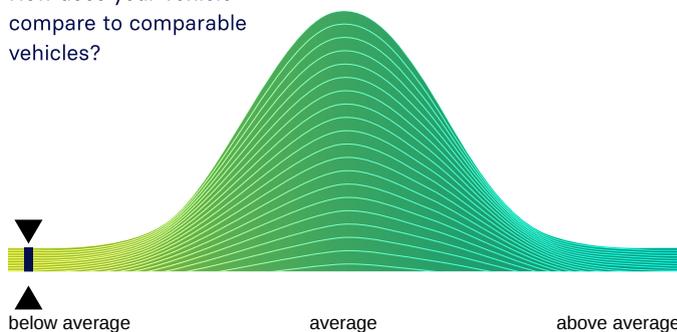

CHECKS

- Battery Management System (BMS) ✓
- Battery Sensor ✓
- Battery Measurements ✓
- Battery Cell Voltages ✓
- Vehicle Communication ✓



SCAN FOR DETAILS


EVALUATION

FAIR HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in fair condition.

The drive battery is therefore officially AVILOO Certified.

Dr. Marcus Berger, CEO

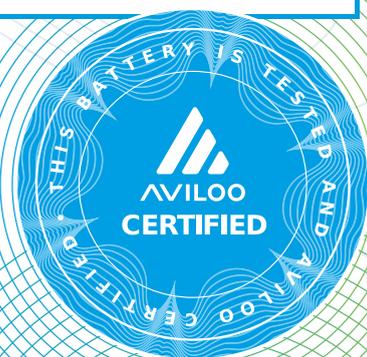

ENERGY

	Gross	Net (Nominal)	Usable
Current:	45.2kWh	43.0kWh	40.3kWh
New:	47.8kWh	45.4kWh	42.6kWh

RANGE

	WLTP	Typical
Current:	293km	210km
New:	310km	222km

EXECUTION PROTOCOL

AVILOO Box connected.		09:29:19
FLASH Test started.		✓
Vehicle detected.		✓
Starting data acquisition.		✓
Finished data acquisition.		✓
Analyzing data.		✓
Analysis completed.		✓

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

BMS


	Value	Status
BMS State of Charge (SoC)*:	91%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	92%	
SoH calculation accuracy:		✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	27.0°C	27.5°C	0.5°C	✓
Cell Voltage	3.316V	3.320V	4mV	✓
Pack Voltage	378.2V			
Average Current	-4.2A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	3.318	3.317	3.318	3.318	3.318	3.317	3.318	3.317	3.318	3.318	3.317	3.317	3.318	3.317	3.318	3.317	3.317	3.318	3.318	3.317
21 - 40	3.318	3.318	3.318	3.317	3.317	3.320	3.317	3.318	3.318	3.318	3.317	3.317	3.318	3.318	3.318	3.317	3.318	3.318	3.318	3.318
41 - 60	3.318	3.318	3.318	3.320	3.318	3.318	3.318	3.318	3.318	3.318	3.317	3.320	3.318	3.318	3.318	3.318	3.318	3.317	3.317	3.318
61 - 80	3.317	3.317	3.318	3.318	3.317	3.317	3.320	3.317	3.318	3.318	3.318	3.317	3.318	3.318	3.318	3.320	3.317	3.317	3.317	3.317
81 - 100	3.317	3.318	3.318	3.317	3.318	3.318	3.318	3.317	3.318	3.318	3.318	3.317	3.317	3.318	3.318	3.318	3.317	3.318	3.318	3.317
101 - 114	3.317	3.317	3.316	3.317	3.316	3.317	3.316	3.316	3.316	3.316	3.317	3.317	3.316	3.316	/	/	/	/	/	/

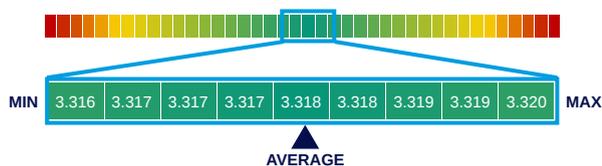

*The values shown here were not calculated by AVILOO but correspond to the values read out from the battery management system (BMS) and were calculated by the manufacturer. AVILOO therefore assumes no liability for their accuracy.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Management System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.